

Roanoke, Town of
(Thomas Feeney House)
Roanoke
Lewis County
West Virginia

HABS No. WV-209-I

HABS
WVA,
21-ROANO,
10-

WRITTEN HISTORICAL AND DESCRIPTIVE DATA

HISTORIC AMERICAN BUILDINGS SURVEY
MID-ATLANTIC REGION NATIONAL PARK SERVICE
DEPARTMENT OF THE INTERIOR
PHILADELPHIA, PENNSYLVANIA 19106

HISTORIC AMERICAN BUILDINGS SURVEY

ROANOKE, TOWN OF
(Thomas Feeney House)

HABS No. WV-209-I

HABS
WVA
21-ROAN,
10-

Location: Roanoke, West Virginia.

Elevation: ca. 1060'.

UTM References as given on the National Register of Historic Places Nomination form:

Zone: 17

Easting: 543950

Northing: 4309030

U.S.G.S. Map: Roanoke, West Virginia, 7.5' (1966 edition, photo revised 1979).

Present Owner: U.S. Army Corps of Engineers.

Present Occupant: none.

Present Use: none.

Construction Date: ca. 1885.

Informants: Blaine Rollyson, Jr.; Lawrence G. Smith; James Whelan.

Historical Information: As in the case of many properties in Roanoke, the Feeney tract was part of a larger parcel of land sold in 1873 by Joseph Hall to William Godfrey and Draper Mitchell. Lot 3 subsequently passed through several owners.

until it was purchased in 1888 by Thomas Feeney who is believed to have built his two story four room dwelling at the rear (i.e., west) portion of the lot about the same time (or some years before) he opened an emporium in Roanoke in 1891; he had previously been associated with the Whitesel store (see HABS No. WV -209-L) at the front (i.e., on east portion) of the lot (James Whelan 1981, pers. comm.). The construction date of 1888 may be accurate, but newspapers found beneath the wallpaper in the upstairs bedrooms (Rooms 7, 8) date from 1884 and 1885 (see below) suggesting that the Feeney dwelling, or at least the original portion of it, may date as early as 1884.

The original part of the Feeney dwelling consisted of a living/dining room (Room 2), entrance hallway (Room 3) and parlor (Room 4) on the first floor, two bedrooms upstairs (Rooms 7, 8) and a front (i.e., east) porch (James Whelan 1981, pers. comm.). To accommodate a family which by 1920 included two boys and two girls, Feeney built about that year a two room ell-shaped addition (Rooms 5, 6) to the dwelling. Room 5 was used as a dining room, while Room 6 functioned as a kitchen. The "old" living/dining room (Room 2) was then converted into a living room (Blaine Rollyson, Jr. 1981, pers. comm.). Room 1 may once have been a porch before it was enclosed.

During the 1920s, when Feeney's business prospered, his home was indeed impressive. Thomas Feeney built a garage for his Reo automobile (Lawrence G. Smith 1981, pers. comm.). Later, he also kept a Buick there. The garage was demolished in 1963. Several large maple (Acer sp.) trees sat in the east and south yards of the house.

A tennis court once stood in front of the garage on the north side

TABLE
Ownership of Tract 1534

Grantor	Grantee	Date of Transaction	Cost	Acreage	Reference	Comments
Mathew B. Woofter (widower of Mary Feeney Woofter) Mathew B. Woofter, Jr. & E. Elizabeth Woofter Mary Jane & Crutcher Wheeler	C. F. Feeney & Thomas V. Feeney, Sr.	9 Jan. 1961	\$1.00	Lot 3	<u>Lewis County Deed Book 271: 439</u>	Peterson survey. Mary Feeney Woofter (deceased) was an heir of Thomas Feeney
W. B. McGary, Special Commissioner	Thomas Feeney	2 April 1888	\$500.25	Lot 3	<u>Lewis County Deed Book 118: 365</u>	Circuit Court in Chancery suit M. E. Whelan, plaintiff; H. L. Powers, defendant
Joseph McCray & Mary E. McCray	H. L. Powers	17 March 1885	\$725.00	Lot 3	<u>Lewis County Deed Book 16: 267</u>	
A. J. McCray & Zolitha McCray James A. McCray & Katharine McCray	Joseph McCray	6 Aug. 1881	\$150.00	Lot 3	<u>Lewis County Deed Book 12: 72</u>	
Charles A. Horner & Mary V. Horner	Hannabal Peterson & J. W. Dyer	24 June 1878	\$900.00	Lot 3 (71 poles)	<u>Lewis County Deed Book 11: 238</u>	
Draper C. Mitchell & Martha Mitchell William J. Godfrey & Sarah Jane Godfrey	Thomas A. Horner & Charles A. Horner (son)	7 June 1873	\$156.00	Lot 3	<u>Lewis County Deed Book 3: 105</u>	
Joseph Hall	Draper C. Mitchell & Martha Mitchell William J. Godfrey & Sarah Jane Godfrey	4 March 1873	\$100.00	4 acres	<u>Lewis County Deed Book 6: 501</u>	

Table (cont.)

Grantor	Grantee	Date of Transaction	Cost	Acreage	Reference	Comments
Michael G. Bush & Amelia Bush (wife)	Joseph Hall	20 Sept. 1847	\$1100.00	86 acres	<u>Lewis County</u> <u>Deed Book N: 59</u>	
John Sprigg & Elizabeth Sprigg	Michael Bush	23 Dec. 1825	\$1200.00	91 acres	<u>Lewis County</u> <u>Deed Book C: 233</u>	

TABLE
Tax Record for Tract 133a

Name	Year	Land	Value per Acre	Value of Land	Value of Improvement	Total Value	Comments
Charles A. Horner	1876-1882	lot (78 poles) Roanoke				\$40.00	
	1883 *1884-1888	lot (78 poles) Roanoke				\$46.00	
Thomas Feeney	1889-1891	Lot 3 (57 poles)				\$40.00	
	1892-1900	Lot 3 (57 poles)				\$110.00	
	1901-1905	part Lot 3				\$110.00	
	1906-1908	part Lot 3		\$300.00	\$800.00	\$1100.00	
	1909-1918	part Lot 3		\$300.00	\$800.00	\$300.00	
	*1919-1921						
	1922-1927	part Lot 3		\$200.00		\$200.00	
	1928-1932	1/4 acre Roanoke		\$180.00		\$180.00	
Thomas Feeney & Bridget Feeney	1933	1/4 acre Roanoke		\$180.00		\$180.00	
	1934-1967	1/4 acre Roanoke		\$100.00		\$100.00	
Anastasia Feeney	1968-1975	1/4 acre Roanoke		\$160.00		\$160.00	
	1976	1/4 acre Roanoke		\$200.00		\$200.00	
Anastasia Feeney & Thomas V. Feeney, Jr.	1977-1978	1/4 acre Roanoke		\$100.00		\$100.00	
Thomas V. Feeney, Jr.	1979-1980	1/4 acre Roanoke		\$100.00		\$100.00	

*Records Missing.

of the dwelling, and there was a small orchard adjacent to the tennis court. In the 1930s the tennis court was converted into a croquet court.

A long brick walk ran from the porch on the east elevation to the sidewalk which bordered the east edge of the property. At night, the walkway was illuminated by two gaslights that could be activated by pulling a cord "which dangled from the mantles." A wire fence kept pedestrians from trampling the grass. A slat or board fence delineated the north side of the Feeney property (James Whelan and Blaine Rollyson, Jr., 1981, pers. comm.).

A back (i.e., south) porch was added to the house in the late 1960s. A few years earlier (ca. 1964), the wire fence in front (i.e., on the east side) of the house was dismantled. As noted above, it was also ca. 1963 that the garage, which mouldered near collapse, was demolished (James Whelan 1981, pers. comm.).

The Feeney house was once regarded as one of the most prominent residences in Roanoke. One may assume that the tennis/croquet court added lustre to the home's appeal. An evening stroll along the sidewalk, bathed as it must have been in the soft glow of gaslight, could hardly have been other than a romantic experience in the little village of Roanoke. With the Feeney store a short distance away, one can imagine that some of the strollers were on their way for ice cream at this family emporium (James Whelan and Blaine Rollyson, Jr., 1981, pers. comm.).

Architectural Information:

General Description: The Feeney dwelling is a two story, three bay (clapboard siding), ell-shaped central chimney 1 house (Glassle 1968a) dwelling with gable roofs; there are porches across the east elevation and at the southwest corner of the addition .

Exterior Description :

Overall Dimensions: 30'4" x 42.'

Foundation: The foundation of the Feeney dwelling consists of piers formed from a combination of square wooden blocks, piles of sandstones and round wooden posts. A rusticated, stone-impressioned sheet metal skirt encloses the foundation .

Walls: The walls are composed of 4 1/2" clapboards applied with cut nails; the clapboards are painted white; corner boards are painted deep red as is the window, door and roof trim.

Framing: This is composed of light timber frame 2" x 6" studs on 1'10"-1'11" centers.

Porch: A porch which measures 7'2 3/4" wide x 26'1" long covers nearly the entire east elevation of the Feeney structure; the deck, which is raised 2' 1/2" above the ground, consists of 2 1/4" boards painted gray on wood joists and is supported on piers composed of piles of sandstone; the porch roof is covered by raised seam sheet metal roofing and is supported by four white 5 1/2" x 5 1/2" square columns with brackets; there is a 7 3/4" plain board baseboard painted gray at the base of the porch next to the house. The porch has an 8' ceiling consisting of 3 1/2" simple-beaded boards painted white; the deck is reached by ascending three concrete steps (50" wide x 11 1/2" tread x 8" high) plus an 8" riser.

A second, more recent porch that measures 8' x 11'3" is located at the southwest corner of the addition along the south elevation ; the deck consists of nine 2'8" x 3'9" concrete slabs resting directly on grade. The lower 2'6" of the porch is

enclosed with corrugated aluminum, and the upper portion was previously enclosed by clear plastic sheeting except for a 6'2 1/2" x 6'3" opening in the south wall. The shed roof of this porch is supported by 2" x 4" columns and is roofed with corrugated aluminum painted silver. Deck to porch ceiling height is 7'.

Chimneys: A stone chimney is centrally located on the roof peak of the original rectangular dwelling; a second chimney, consisting of a stove pipe, is located on the roof peak of the main addition and is offset toward the east.

Roof: The medium-pitch variety gable roof of the original structure is covered by raised seam sheet metal roofing, while the addition is covered by corrugated sheet metal. The shed roof of a second addition is covered by felt paper painted silver. The eaves and raking trim of the original dwelling consist of boxed cornice with frieze; the raking trim has partial frieze returns. The eaves and raking trim of the principal addition consist of a boxed cornice with frieze. The second addition along the west wall has a sheet metal gutter and downspout.

Interior Description: Room 1 (room numbers are keyed to floor plans on pages 27-28)

Function: Unknown; may originally have been a porch before it was enclosed to form room.

Dimensions: 9'10" x 13'10"; ceiling 6'1" at west side, 7'6" at east side.

Wallcovering: east and south walls consist of 4 1/2" exterior clapboards of house; north and west walls are 4 1/8" unpainted plain boards.

Floorcovering: 5"-9 1/4" plain boards; central area covered with linoleum; area beyond linoleum unpainted.

Ceiling: 4 1/2"-9 3/4" unpainted plain boards.

Baseboard: none.

Heating: none.

Fireplace: none.

Plumbing: none.

Lighting and Electricity: central ceiling fixture with pullcord; duplex outlet on north wall.

Stairway: room can be entered from the exterior by ascending a single broken piece of concrete that functions as a crude step plus a 9 1/2" riser.

Other: exterior walls are insulated with sawdust. This is the only example of this insulation technique observed in the current project.

Interior Description: Room 2

Function: living room/dining room; later living room.

Dimensions: 12'9 1/2" x 16'7"; 7'7 1/2" ceiling.

Wallcovering: 5"-9" horizontal boards; covered with corrugated cardboard; cardboard painted yellow.

Floorcovering: 5 1/2"-6 1/4" plain boards; central area covered with linoleum; area beyond linoleum painted gray.

Ceiling: 2 5/8"-4 1/4" plain boards; painted white; 2" molding around edges of ceiling.

Baseboard: 8 1/4" plain board with cap molding; quarter round shoe; painted white.

Heating: fireplace; gas connection on south side of fireplace.

Fireplace: brick; 1'11 1/2" x 4'4" concrete hearth; wooden mantle.

Plumbing: none.

Lighting and Electricity: central ceiling fixture with pullcord; duplex outlet on north wall opposite fireplace; electrical line in closet.

TABLE
Tract 1534: Door Details

Position*	Opening	Style	Hinge	Latch/Lock	Interior Surround Trim	Exterior Surround Trim	Threshold
Room 1 to Exterior	2'9" x 6' 1/4"	3 5/8"-6 1/2" vertical boards on exterior; 4 7/8" horizontal boards on interior	4 5/8" strap	drop-in-board	1 5/8" plain boards	none	yes
Room 1 to Room 2	2'6" x 6'5 1/8"	4 panel	3" ornate cast pin butt	rim lock (missing); drawer pull handle	4 1/2" mold	4 1/2" mold	yes
Room 2 to Closet	2'6" x 6'5 1/8"	4 panel	3" ornate cast pin butt	rim lock (missing)	4 1/2" mold	4 1/2" mold	yes
Room 2 to Stairway	2'5 1/2" x 6'4"	3 panel	3 3/8" pin butt	previously rim lock; drawer pull type handle	4 1/2" mold	4 1/2" plain boards	yes
Room 2 to Room 3	2'6" x 6'5 3/4"	4 panel with transom	3" ornate cast pin butt	previously rim lock; drawer pull type handle	4 1/2" mold	4 1/2" mold	no
Room 3 to Exterior	2'5 3/4" x 6'5 1/2"	4 panel with transom	3" ornate cast pin butt	3 1/4" x 2 1/4" rim lock; modern dead bolt	4 1/2" mold	4 1/2" mold	yes
Room 3 to Room 4	2'6" x 6'6 1/2"	door missing; transom	3" butt	—	4 1/2" mold	4 1/2" mold	no
Room 4 to Closet	2'6" x 6'7"	door missing	—	—	4 1/2" mold	4 3/4" plain boards	no

Table (cont.)

Position*	Opening	Style	Hinge	Latch/Lock	Interior Surround Trim	Exterior Surround Trim	Threshold
Room 4 to Room 5	5'7 1/2" x 6'8 1/2"	passageway (previously smaller doorway)	—	—	4 1/2" plain boards	4 1/2" plain boards	yes
Room 5 to Room 1	2'5 3/4" x 6' 5/8"	4 panel	3" pin butt	4 3/4" x 3 1/4" rim lock; modern sliding bolt	4 1/2" mold	4 1/2" mold	yes
Room 5 to Room 6	2'6 1/4" x 6'5 1/2"	door missing	3" ornate cast pin butt	—	4 1/2" mold	4 1/2" mold	yes
Room 6 to Exterior	2'7 3/4" x 6'2 1/2"	4 1/2"-7" vertical boards and 2 batten	3 3/8" modern pin butt	5" x 3 5/8" rim lock; porcelain knob on exterior; interior knob ornate metal	4 5/8" plain boards	3 1/4" plain boards	yes
Room 7 to Room 8	2'5 7/8" x 6'2 1/8"	3 panel	3 1/2" pin butt	missing rim lock	4 1/4" mold	4 1/4" mold	yes
Room 8 to Closet	2'5 1/4" x 6'2 1/2"	door missing	—	—	4 1/4" mold	4 1/4" plain boards	yes

*For exact positions, refer to Figures

TABLE
Tract 1334: Window Details

Position*	Style	Opening	Size of Pane	Number of Panes	Type of Sill	Interior Surround Trim	Exterior Surround Trim
EAST WALL First Floor Left to right	double hung	30" x 54 3/8"	12 1/4"x24 3/8"	2/2	slip	4 1/2" mold	4 1/2" mold
	double hung	30" x 54 3/8"	12 1/4"x24 3/8"	2/2	slip	4 1/2" mold	4 1/2" mold
	double hung	30" x 54 3/8"	12 1/4"x24 3/8"	2/2	slip	4 1/2" mold	4 1/2" mold
Second Floor Left to right	double hung	29" x 54"	12 1/4"x21 3/8"	2/2	slip	4 1/4" mold	1 1/4" plain boards
	double hung	29" x 54 1/2"	12 1/4"x21 3/8"	2/2	slip	4 1/4" mold	1 1/4" plain boards
SOUTH WALL First Floor Left to right	double hung	29 1/4" x 64"	12" x 14"	4/4	slip	4 1/2" mold	1 1/2" plain boards
	double hung	29" x 54"	12" x 24"	2/2	slip	3 1/4" plain boards	3 1/4" plain boards
	double hung	29" x 54"	12 1/4"x24 3/8"	2/2	slip	4 1/4" mold	1 1/4" plain boards

Table (cont.)

Position*	Style	Opening	Size of Pane	Number of Panes	Type of Sill	Interior Surround Trim	Exterior Surround Trim
WEST WALL First Floor Left to right	double hung (obscured by addition)	29" x 53 1/2"	12 1/4"x24 3/8"	2/2	slip	4 1/2" mold	4 1/4" mold
	double hung (obscured by addition)	29" x 53 1/2"	12 1/4"x24 3/8"	2/2	slip	4 1/4" mold	3 3/4" mold
Second Floor Left to right	double hung	33" x 69"	14" x 32"	2/2	slip	4 1/4" mold	1 1/4" plain boards
	double hung closed when addition built	29" x 54 1/2"	12" x 24"	2/2	slip	4 1/4" mold	--
NORTH WALL First Floor Left to right	double hung	29" x 64"	12" x 14 1/8"	4/4	slip	3 3/4" mold	1 1/4" plain boards

*For exact positions, refer to Figures

Stairway: enclosed stairway consists of 14 steps (29 1/2" width x 9 3/4" tread x 6" rise) with a 1" nose and a 6 1/2" riser in the northeast corner of the room .

Other: closet at the west end of the north wall beneath the stairway.

Interior Description: Room 3

Function: hallway.

Dimensions: 5'7" x 6'1"; 7 1/2" ceiling.

Wallcovering: 6 3/4" plain boards covered with linen then wallpaper.

Floorcovering: 5 1/2"-6 1/4" plain boards; unfinished; covered with linoleum.

Ceiling: 2 5/8"-4 1/4" plain boards; 2" crown molding around edges of room; painted white.

Baseboard: 8 1/4" plain board; quarter round shoe; painted white.

Heating: none.

Fireplace: none.

Plumbing: none.

Lighting and Electricity: none.

Interior Description: Room 4

Function: parlor.

Dimensions: 9'6 1/4" x 16'7"; 7'10" ceiling.

Wallcovering: 3 3/4"-7 1/4" horizontal plain boards covered with corrugated cardboard, then wallpaper.

Floorcovering: 6 1/2" plain boards covered with wall-to-wall carpeting.

Ceiling: 4 1/2"-7" plain boards; painted white; quarter round around edges of room.

Baseboard: both 6" and 8" plain board with cap molding; painted white .

Heating: fireplace; gas connection on west side of fireplace.

Fireplace: brick; 1'10 1/2" x 4'5" concrete hearth; wooden mantle .

Plumbing: none.

Lighting and Electricity: central ceiling fixture with pullcord; duplex outlet on west wall.

Other: closet at northwest corner of room.

Interior Description: Room 5

Function: dining room.

Dimensions: 13'2" x 13'2"; 8'1 1/2" ceiling.

Wallcovering: 4" tongue and groove boards; painted dark drab green; covered with corrugated cardboard, then wallpaper.

Floorcovering: 4 1/4" tongue and groove boards; central area previously covered; periphery of room painted gray.

Ceiling: 4 1/4" tongue and groove boards; painted white.

Baseboard: 7 1/2" plain board; painted white.

Heating: gas connection on south wall; stove pipe opening in ceiling.

Fireplace: none.

Plumbing: none.

Lighting and Electricity: ceiling fixture offset to south with pullcord; duplex outlets on south and north walls.

Interior Description: Room 6

Function: kitchen.

Dimensions: 10'1" x 13'2"; 8'1 3/4" ceiling.

Wallcovering: 4" tongue and groove boards; painted bright green; covered with corrugated cardboard, then wallpaper.

Floorcovering: 4 1/4" tongue and groove boards covered with linoleum.

Ceiling: 3 1/2"-4 1/4" tongue and groove boards; painted white; quarter round at corners of room.

Baseboard: 3 1/2" plain board; some quarter round shoe; painted white.

Heating: gas connection on west wall.

Fireplace: none.

Plumbing: sink unit along west end of south wall.

Lighting and Electricity: central ceiling fixture with pullcord; light switches on south wall at west side of door and on north wall; duplex outlet on south wall.

Interior Description: Room 7

Function: bedroom.

Dimensions: 15'3 1/2" x 16'6"; 7'7 1/2" ceiling.

Wallcovering: 1'3"-1'7" plain boards covered by newspaper, then wallpaper; wallpaper painted yellow.

Floorcovering: 4"-9 1/2" plain boards; central area previously covered (carpet?; linoleum?); boards around periphery of room painted brown.

Ceiling: 3 1/2" tongue and groove boards; painted white; 2 1/2" crown mold around edges of room.

Baseboard: 7 3/4" plain board with cap molding; painted dull pink.

Heating: gas connection on south wall.

Fireplace: none.

Plumbing: none.

Lighting and Electricity: none.

Stairway: open stairwell surrounded by 2'10" high railing; rectangular bannister with beveled edges and rectangular cross section balusters.

Other: newspapers used as underlayment beneath wallpaper: The Republican April 12, 1884, August 15, 1885, October 3, 1885; Chicago Weekly News June 4, 1885, January 15, 1885.

Interior Description: Room 8

Function: bedroom.

Dimensions: 10'10" x 16'6"; 7'5" ceiling.

Wallcovering: 9"-17" plain boards covered with layers of newspapers (ca. 1884-1885), corrugated cardboard, then wallpaper.

Floorcovering: 5 3/4"-8" plain boards; previously covered with linoleum; periphery of room painted dark brown.

Ceiling: 2 1/2"-4 1/2" tongue and groove boards; painted white; 2 1/4" crown molding around edge of room.

Baseboard: 7 1/4" plain board with cap molding; painted cream.

Heating: 10 3/4" x 17 3/4" grate in floor of room near west wall.

Fireplace: none.

Plumbing: none.

Lighting and Electricity: central ceiling fixture with pullcord; duplex outlet on west wall.

Other: closet in northeast corner of room.

Site:

General Setting and Orientation : The Fenney dwelling sits back from West Virginia County Route 19/24 ca. 135'; today, the building is essentially isolated although the lot may be more properly described as spacious. To the south and southwest ca. 200' flows the West Fork River. The dwelling is 156' south of West Virginia County Route 23/5 (the old Weston and Gauley Bridge Turnpike) and faces almost due east.

Historic Landscape Design: A Norway spruce (*Picea* sp.) is adjacent to the north side of the front (i.e., east) steps; a 14' circumference maple (*Acer* sp.) is at the southeast corner of the dwelling. A birch (*Betula* sp.) tree is found 36' north of the dwelling, while two large maple (*Acer* sp.) trees are directly in front (i.e., east) of dwelling at the edge of West Virginia County Route 19/24. A forsythia (*Forsythia* sp.) bush is found at the southwest corner of the house, and a rose-of-sharon (*Hibiscus* sp.) is south of the house. A clothes line extends southwest of the dwelling. A 1'8" wide flagstone walkway leads from Room 1 to exterior door to a privy.

Outbuildings: 4'2 1/2" x 5'2" two-seat privy is located ca. 70' north of the dwelling. A garage was previously associated with the dwelling but was removed in 1963 (see Historical Information section above).

For project information and bibliography, see ROANOKE HABS No. WV-209.

For other structures in the Roanoke area, see HABS No.s WV-209-A -S.

The report from which this HABS documentation was prepared, along with field notes and over 90 hours of interview tapes, will be archived at the University of West Virginia, Morgantown, West Virginia.



The Feeney store ca. 1928. Note the covered bridge over the West Fork River at left. The Feeney store sat approximately on the site of the present (1981) Roanoke U.S. Post Office. The Feeney dwelling is located to the right of the store out of this picture (James Whelan Photograph Collection).



The east and north elevations of the Feeney dwelling in 1981. This photograph shows the general landscape near the structure. Note the large maple (Acer sp.) tree at left.



Perspective control photograph of the east elevation of the Feeney dwelling in 1981. Note the non-symmetrical positioning of windows in this elevation.



Perspective control photograph of the south and east elevations of the Feeney dwelling in 1981.



Perspective control photograph of the south elevation of the Feeney dwelling in 1981.



Close-up of boxed cornice eaves and frieze along the south elevation of the addition to the Feeney dwelling in 1981.



Close-up of boxed cornice and frieze raking trim on the south elevation of the Feeney dwelling in 1981. Note the partial return on the frieze.



Perspective control photograph of the south and west elevations of the Feeney dwelling in 1981. Note the large maple (Acer sp.) tree at left.




Perspective control photograph of the west elevation of the Feeney dwelling in 1981. This photograph clearly shows the relationship of the addition to the main portion of the structure.



The west and north elevations of the Feeney dwelling in 1981. This photograph shows the general landscape near the structure. At left is the Whitesel store/Odd Fellows Lodge on Tract 1540.



Perspective control photograph of the west and north elevations of the Feeney dwelling in 1981. Note the corrugated sheet metal roof as well as the stone chimney centrally located on the roof peak.

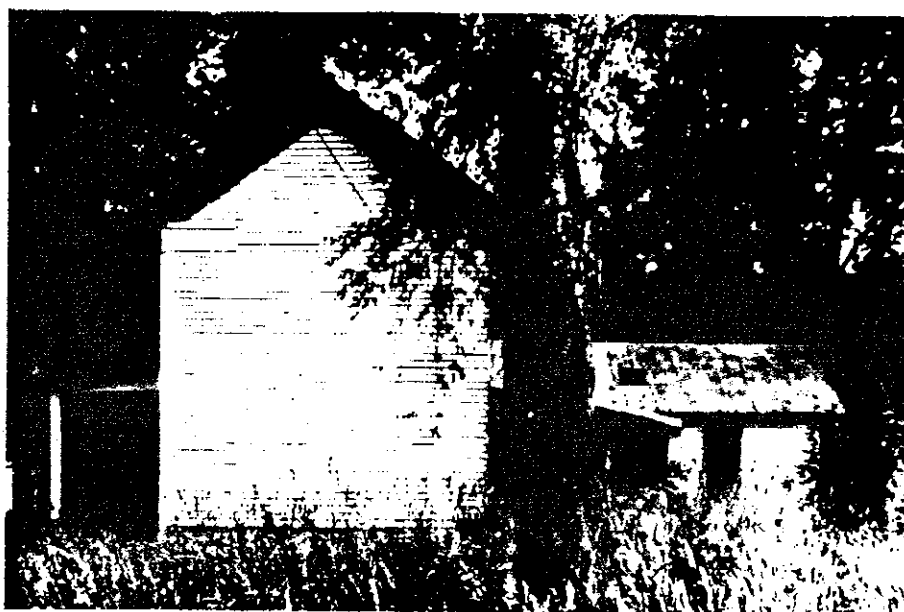

Perspective control photograph of the north elevation of the Feeney dwelling in 1981. Note the shed roof porch attached to the east elevation.



Perspective control photograph of the north and east elevations of the Feeney dwelling in 1981. Note the rusticated stone-impressioned sheet metal skirt around the foundation.



Close-up of clapboards at the northeast corner of the Feeney dwelling in 1981.




Close-up of shed roof porch attached to the east elevation of the Feeney dwelling in 1981. This view looks north to south. Note decorative barge board along raking trim.



Close-up of column and bracket of porch on the east elevation of the Feeney dwelling in 1981.




Close-up of the north 2/2 window in the east wall of Room 1 of the Feeney dwelling in 1981. The clapboard siding clearly demonstrates that this was once an exterior wall of the structure.

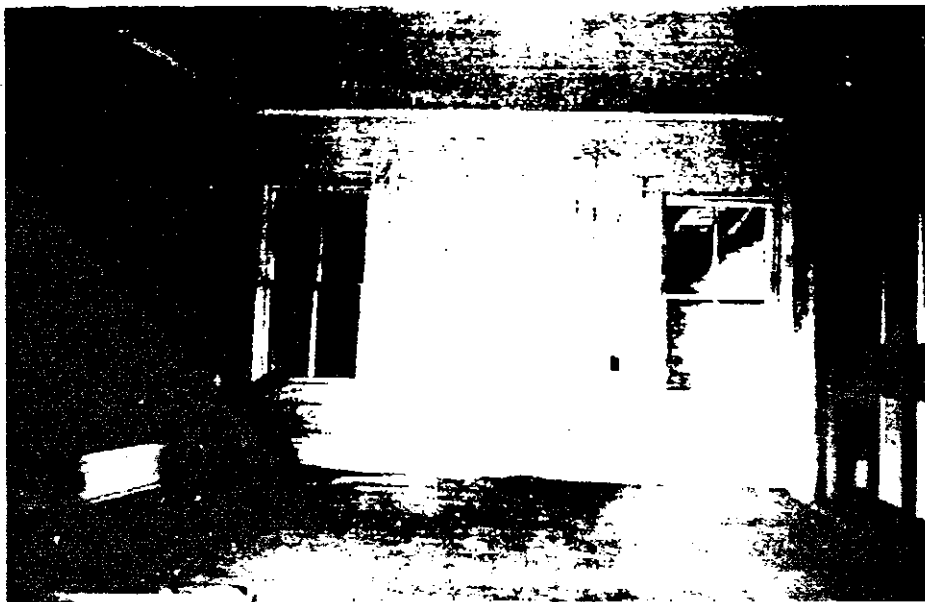

West wall of Room 2 of the Feeney dwelling in 1981. This photograph indicates how little modification was done to the west elevation of the original structure when the Room 1 addition was added.




South wall of Room 2 of the Feeney dwelling in 1981. The door to Room 3 (hallway) is at left. Note the horizontal board wall composed of different width boards to the left and right of the fireplace.

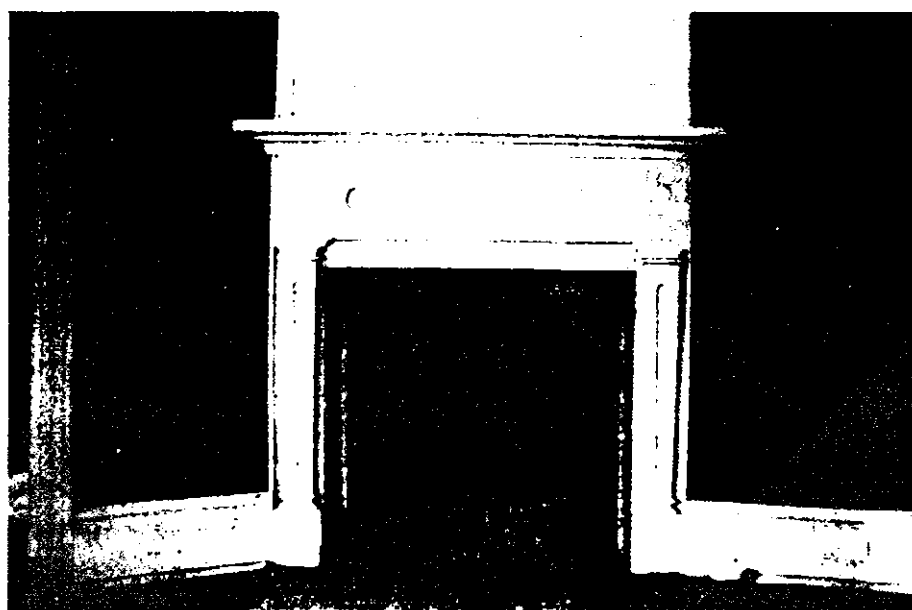

Close-up of fireplace and mantle in Room 2 of the Feeney dwelling in 1981.



Close-up of fireplace and mantle in Room 4 of the Feeney dwelling in 1981.
Contrast this mantle with that in Room 2 (Figure 274).

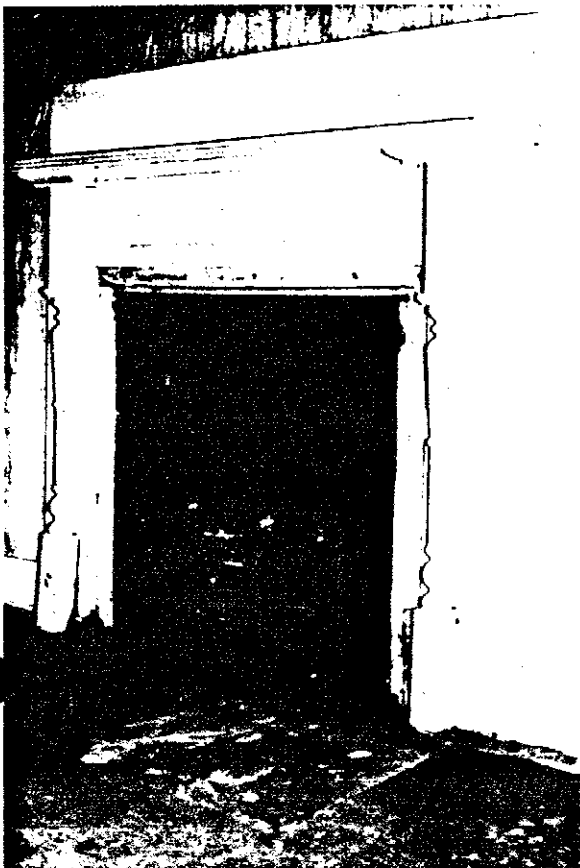


Close-up of fireplace and
mantle in Room 4 of the Feeney dwell-
ing in 1981.



Close-up of decorative detail on Room 4 mantle in the Feeney dwelling in 1981.




Close-up of 2/2 window in east wall of Room 4 of the Feeney dwelling in 1981. Note the ornate corner blocks and surround trim.

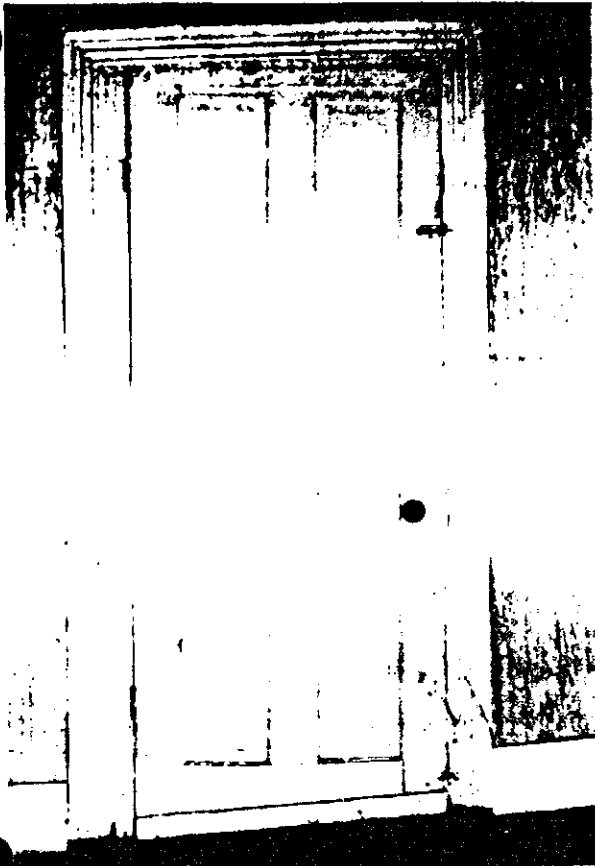


Close-up of Room 1 to
Room 5 door from Room 5 in the
Feeney dwelling in 1981. Note the
bottom of the door.




Close-up of Room 6 to
exterior board and batten door in the
Feeney dwelling in 1981.

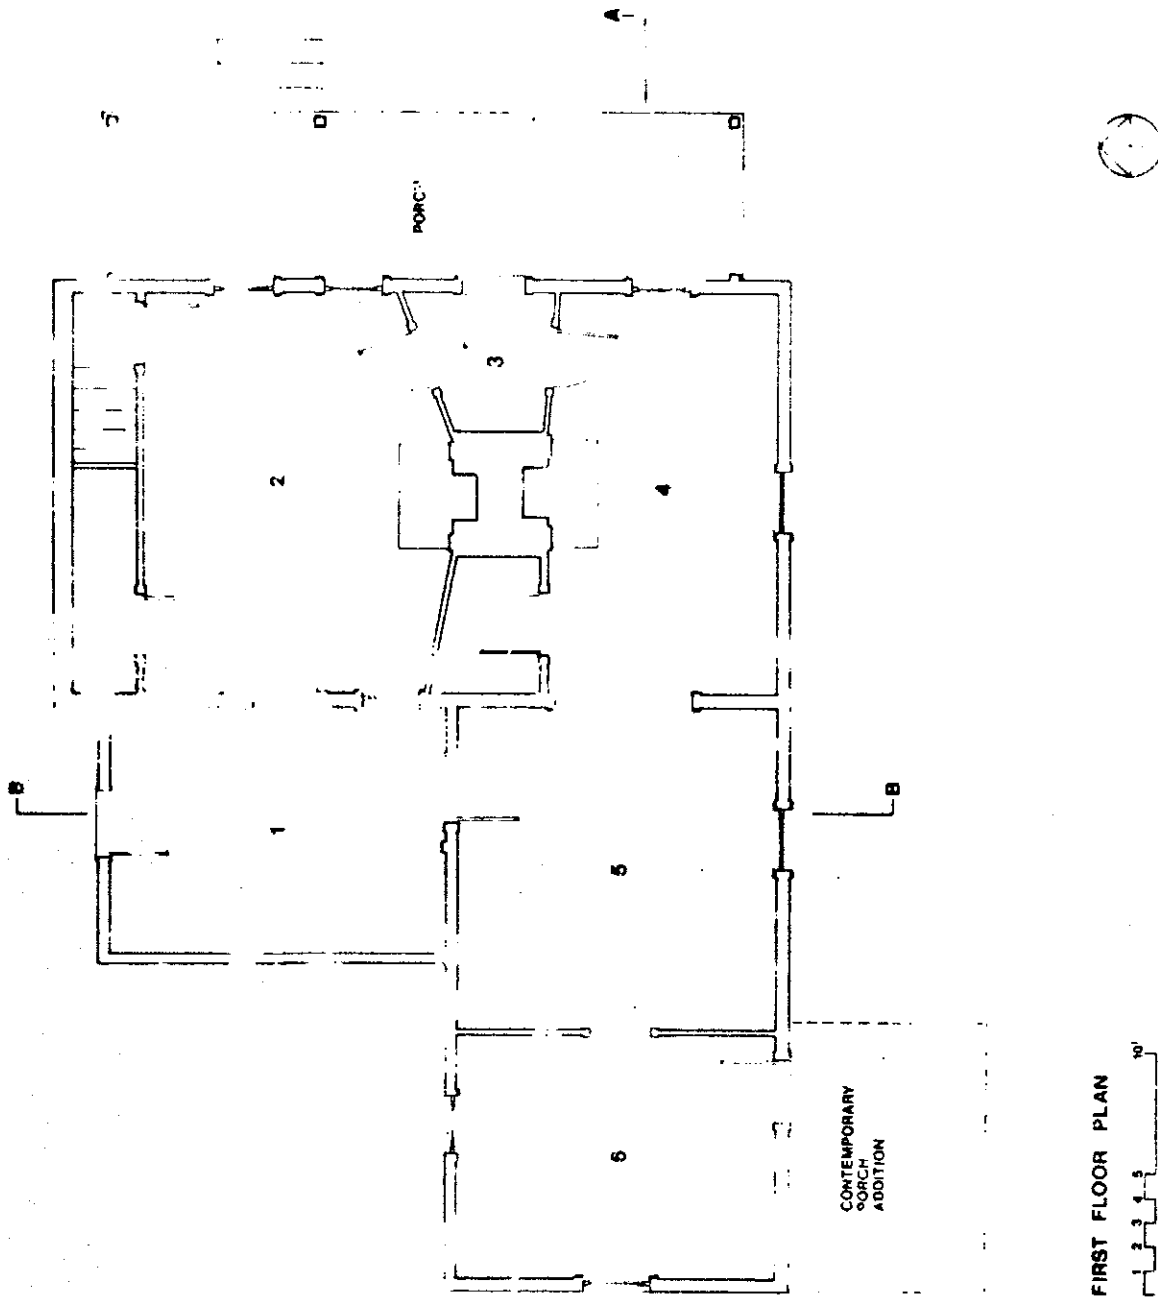

First floor plan of the Feeney dwelling.

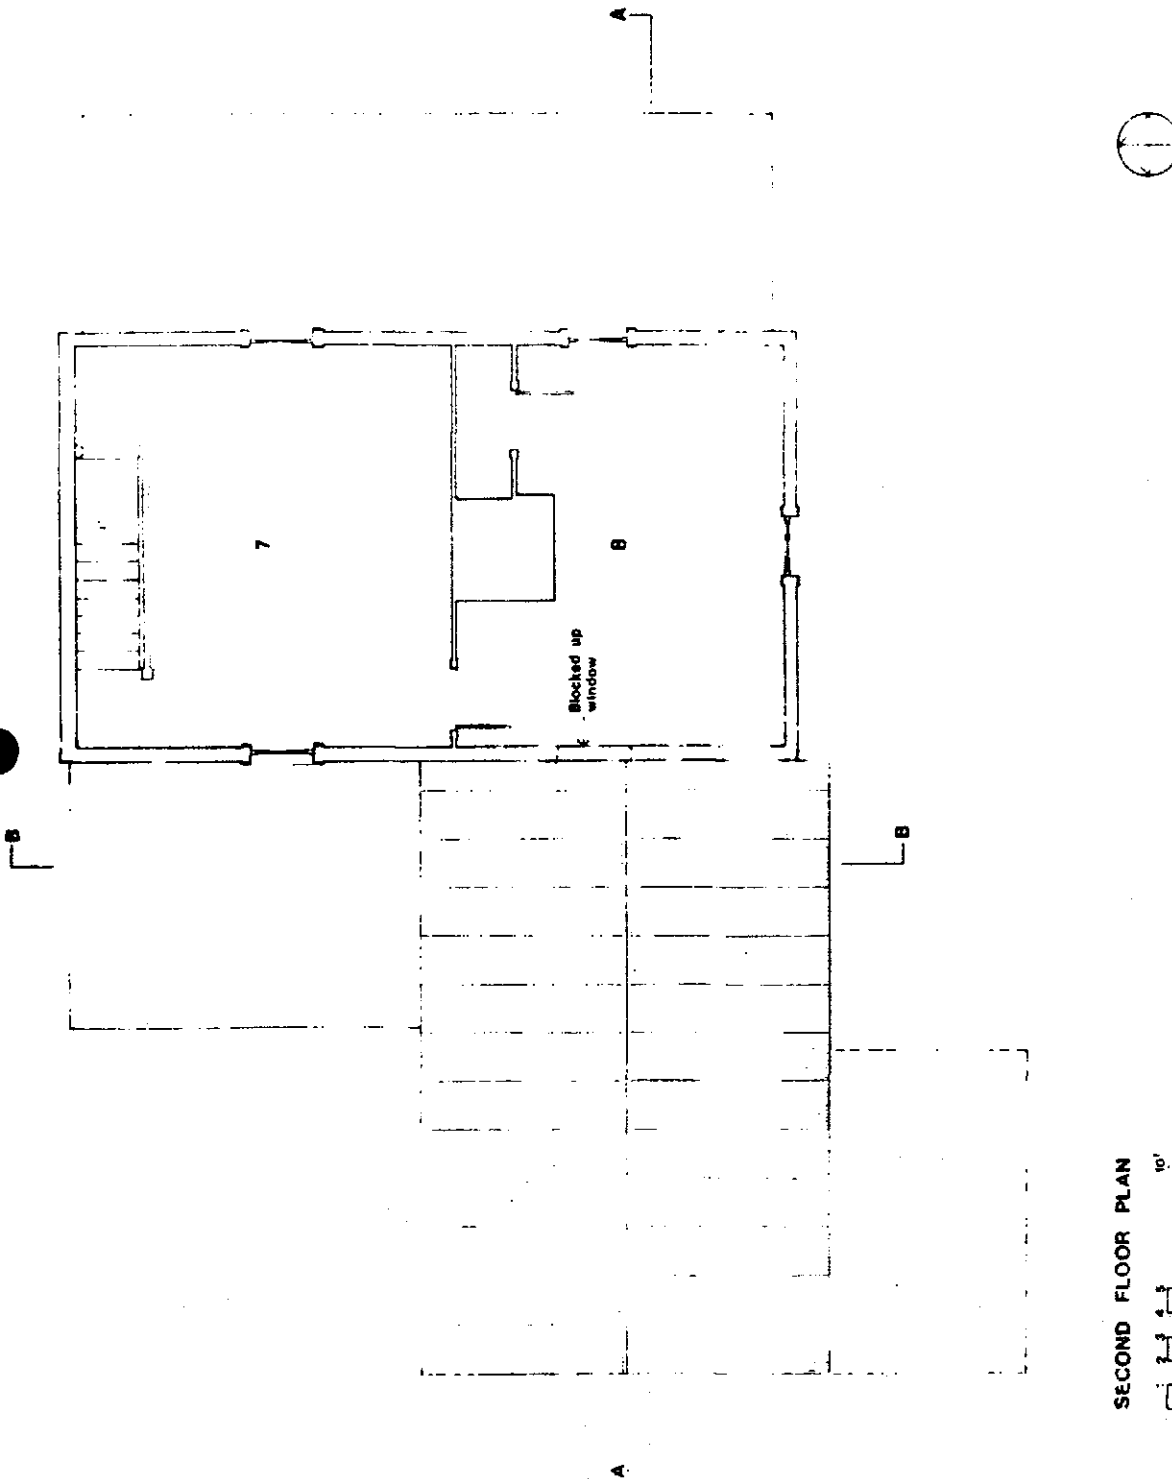


Second floor plan of the Feeney dwelling.

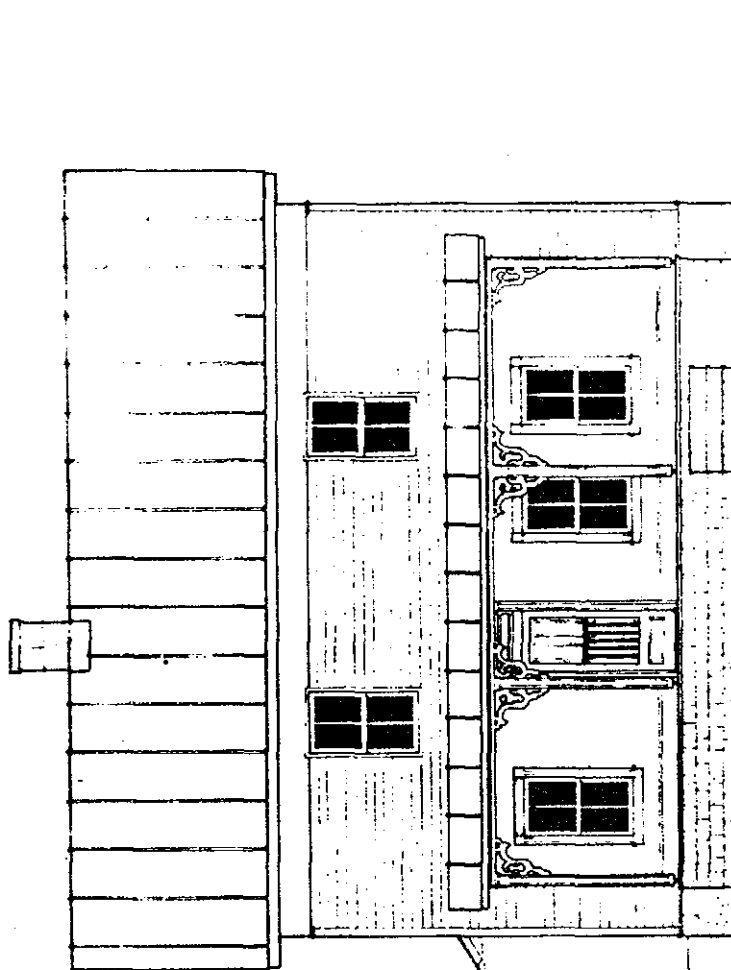

EAST ELEVATION




East elevation of the Feeney dwelling.

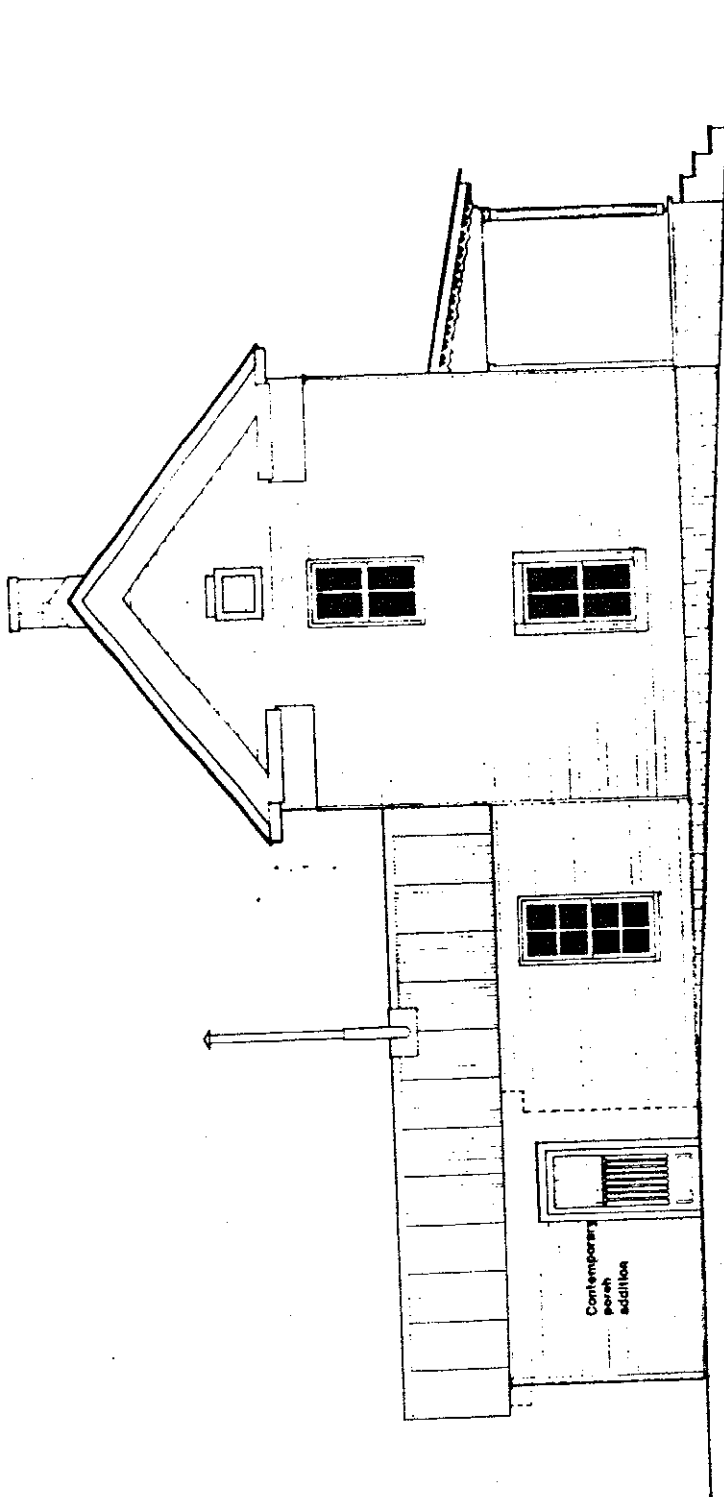

SOUTH ELEVATION
1 2 3 4 5 10'

South elevation of the Feency dwelling.

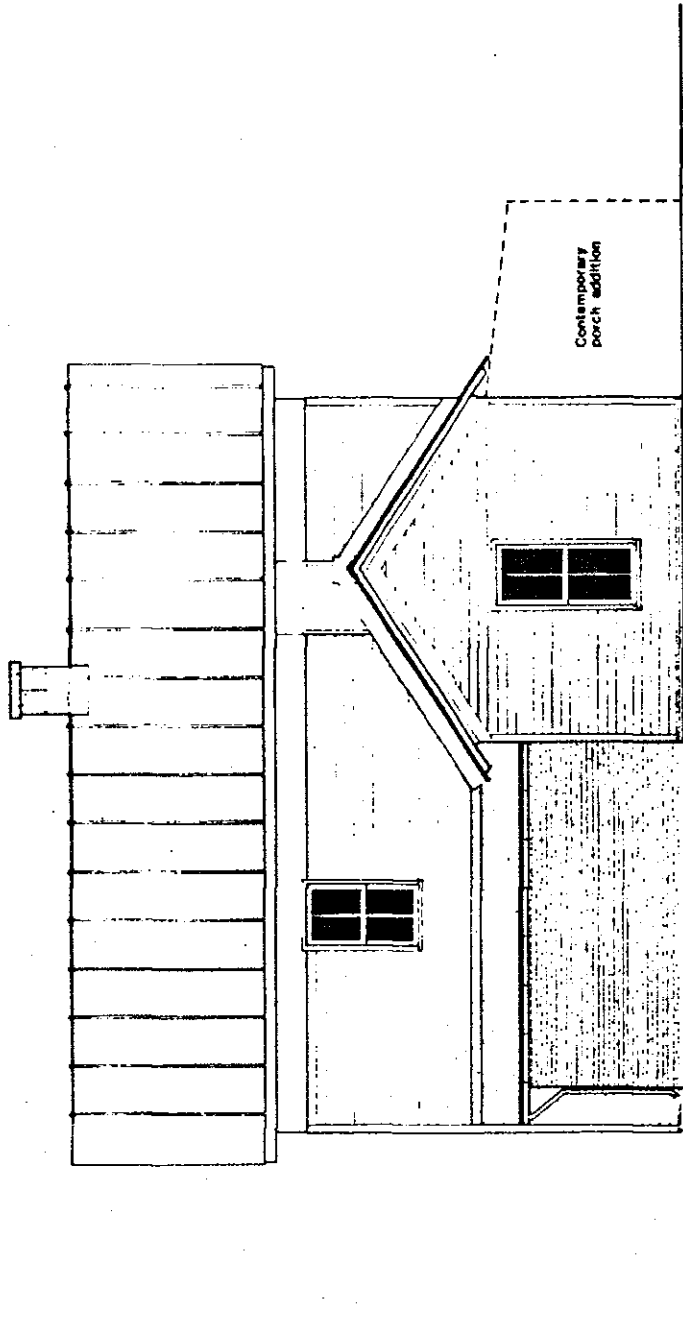


WEST ELEVATION



West elevation of the Feeney dwelling.




North elevation of the Feeney dwelling.

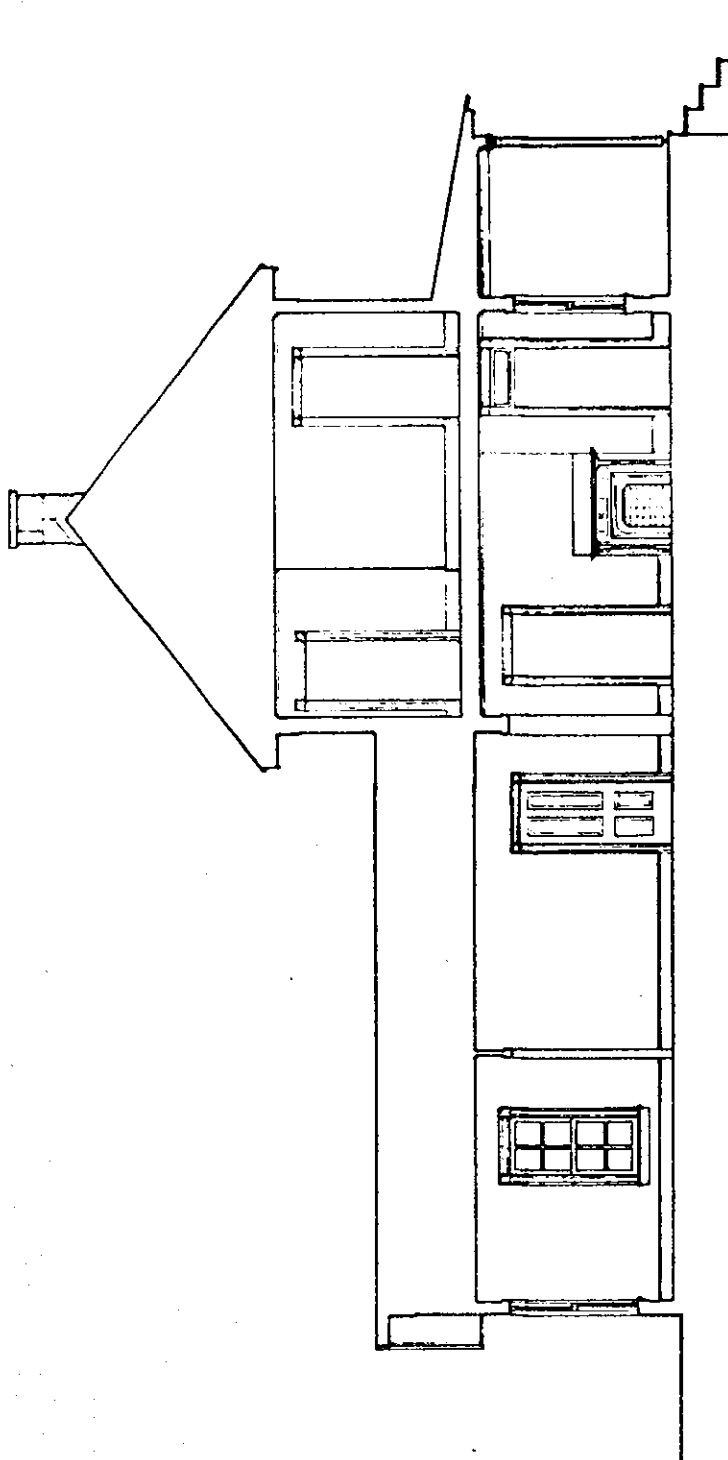


SECTION A-A
1" = 12'


Longitudinal section (A-A) through the Feeney dwelling.

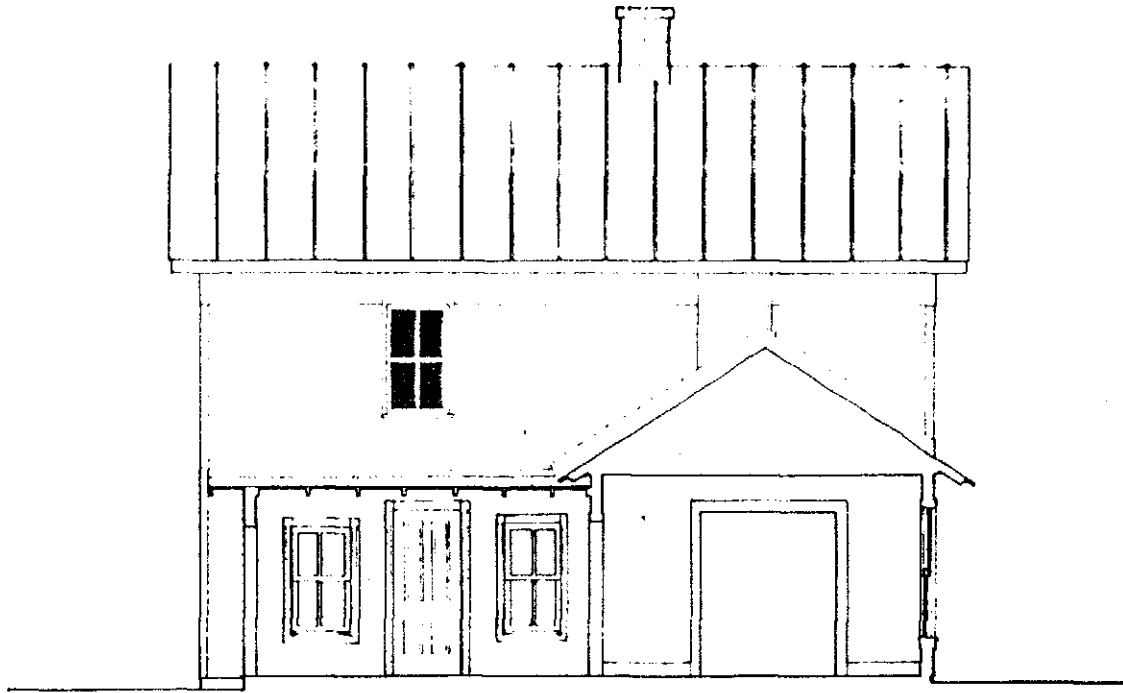


SECTION B-B




Transverse section (B-B) through the Feeney dwelling.

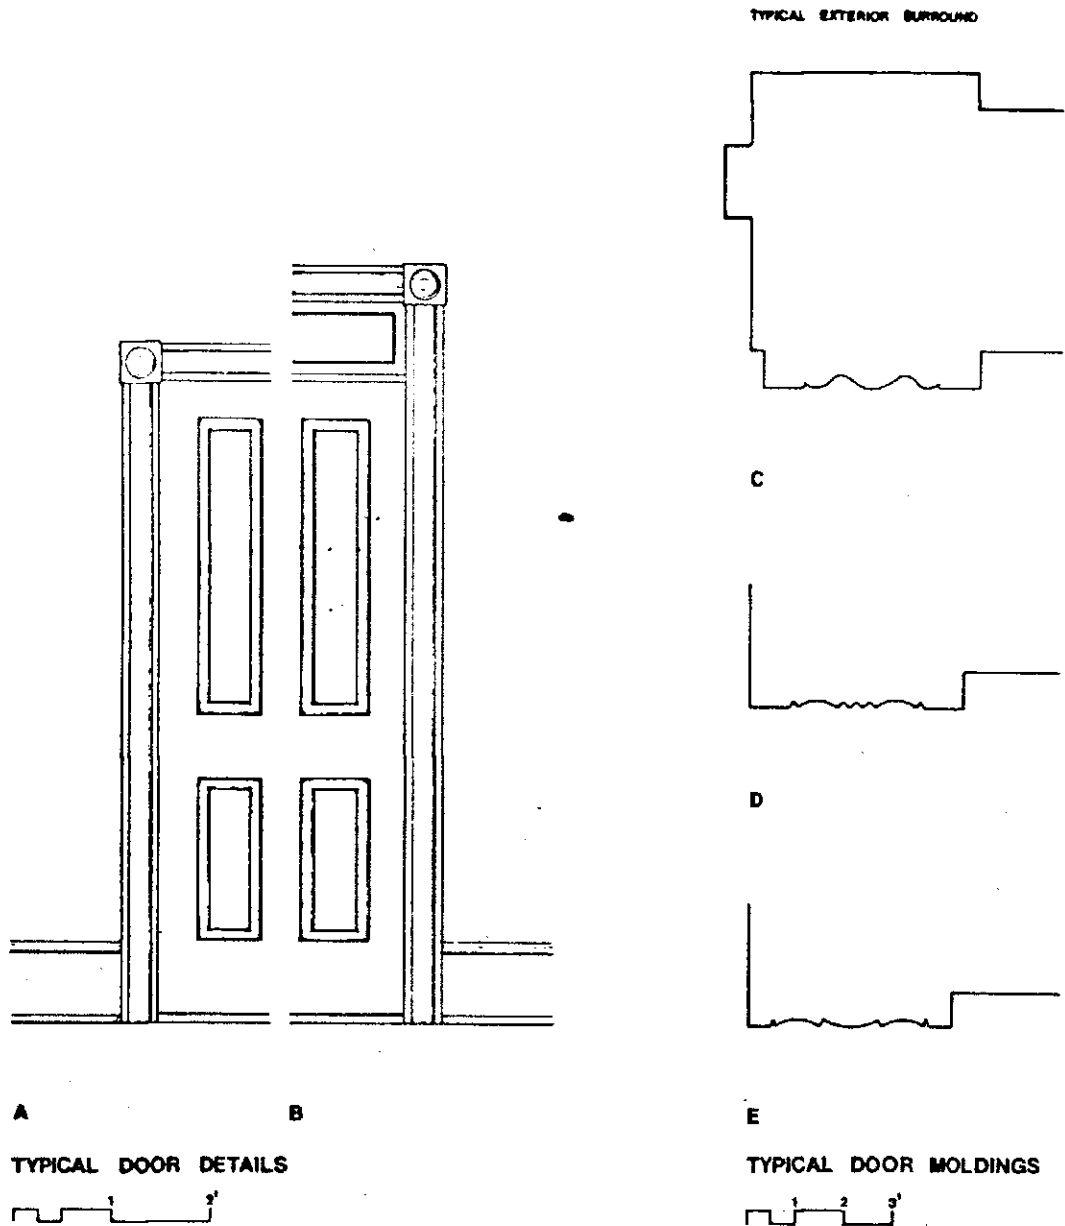


Typical door details in the Feeney dwelling.

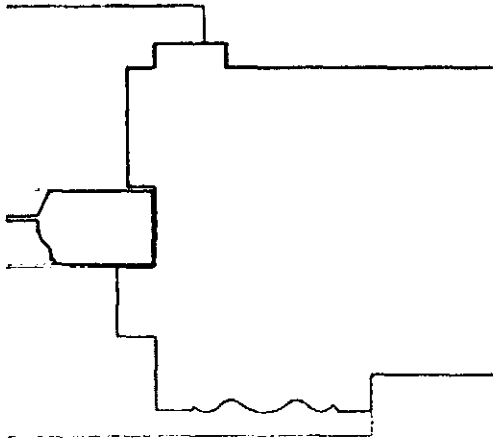

B


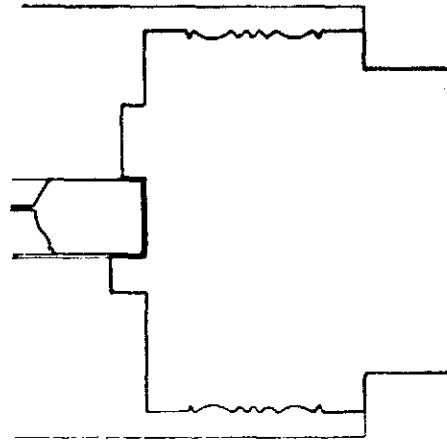


C

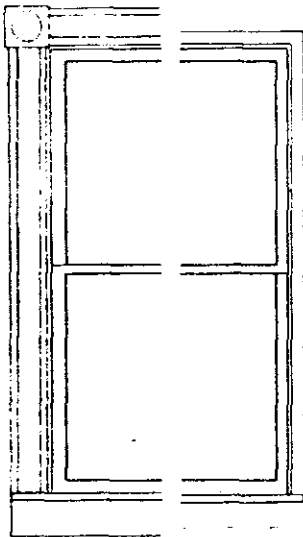

A
INTERIOR ELEVATION
EXTERIOR ELEVATION ROOMS
2 & 4 WINDOWS EXTERIOR ELEVATION

TYPICAL WINDOW DETAILS

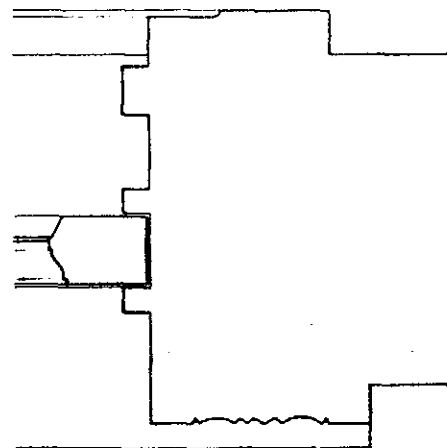


D




E

TYPICAL WINDOW MOLDINGS




Typical window details in the Feeney dwelling.

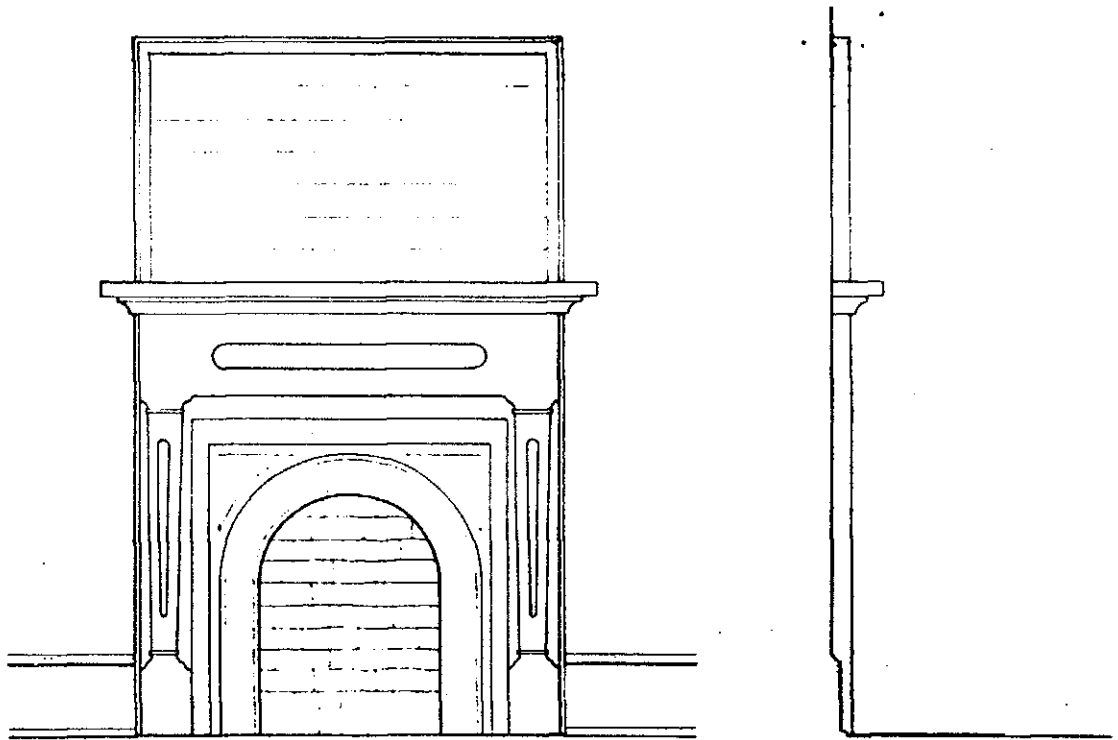

FIREPLACE MANTEL ROOM 2



Fireplace mantle details in Room 2 of the Feeney dwelling.

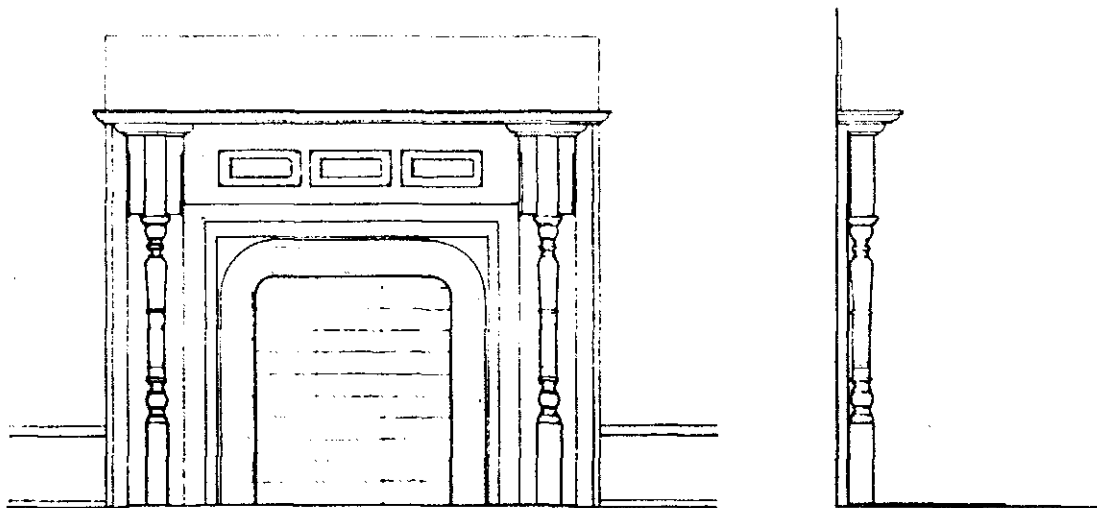

FIREPLACE MANTEL ROOM 4

Fireplace mantle details in Room 4 of the Feeney dwelling.